



1 PREPARE 2 TREAT 3 MAINTAIN

# MAINTENANCE GEL

## APPLICATION AREA

Maintenance Gel is for the care and maintenance of oiled indoor wooden surfaces. The gel is suitable for furniture, kitchen work surfaces, floors and other indoor wooden surfaces. Especially suitable for UV-oiled floors.

## RESULT

Maintenance Gel is quick-drying and leaves an attractive, water- and dirt-repellent surface. It can also be used for improved results on factory-oiled/UV-oiled surfaces.



buffing

### Easy to apply

Application and buffing can be done by hand with a hand scrubber.



4-6h

### Quick drying

Dry in 4-6 hours for light use/fully hardened in 2-3 days.



UV-oil

### Ideal for UV-oil

Especially suitable for revitalization and maintenance of UV-oiled/factory-oiled wood floors.



maintain

### Easy to maintain

No special tool required. Just use the standard WOCA system.

## Product information

Coverage:  
Regular maintenance: 215-323 SF/200 ml.  
Newly-sanded/non-maintained wood:  
215-323 SF/L  
Packaging: 200 ml  
Available in Natural, White and Extra White

Natural

White

Extra White



# HOW TO...

## ...MAINTAIN INDOOR WOODEN SURFACES

### Tools

The gel is preferably applied with a WOCA Hand Scrubber

### Preparation

Thoroughly clean the surface with WOCA Intensive Wood Cleaner, mixed 1 part cleaner to 20 parts water. Then wash with clean water. After cleaning, leave the surface to dry for at least 8 hours at 20 °C. In case of grain raising, an advantage would be slightly to de-nib with fine sand paper or sanding pad (remove any sanding dust from the surface).

It is important that the product, the room and the floor are at a temperature between 59°F and 86°F and that air humidity is approx. 50%. Wood humidity must not exceed 12%. Make sure that the room is well-ventilated for optimal evaporation and drying time.

### Risk of self-ignition!


Any cloths that are soaked in gel should be stored/disposed of in sealed containers or incinerated due to risk of self-ignition.

### Please note


The oiled surface should not be exposed to water for the first 2-3 days when the gel is hardening, as this can cause stains and discoloration.

### Maintenance

For regular cleaning, we recommend using WOCA Natural Soap. For enhanced durability, clean with WOCA Oil Refreshing Soap every 2-6 weeks, or when necessary.

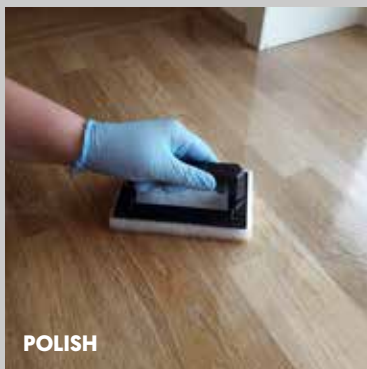

POLISH

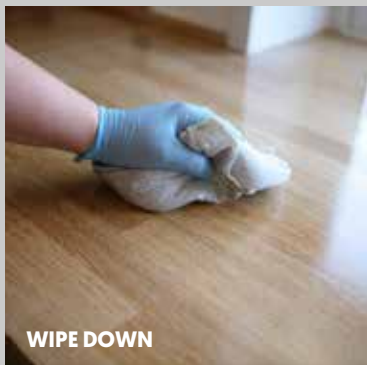

WIPE DOWN

## INSTRUCTIONS

- 1 Apply an appropriate amount of gel to a red/white Hand Scrubber and distribute over the surface in a thin, even coat. Continue polishing until the wood seems saturated and the surface has a uniform appearance.

It is recommended to work on small areas at a time, as the gel is quick/drying. For larger areas (floors larger than 100 SF) it would be advantageous to use a polishing machine.

- 2 Immediately wipe down the polished surface with a clean, dry lint-free cotton cloth. When prepping with a machine, the final polishing should be done with a cotton cloth beneath the buffer. The surface should not appear wet and no excess gel should remain on the surface.

- 3 If the wood does not seem fully saturated after 4-6 hours, it would be advantageous to repolish, with less gel than the first treatment, but following the same procedure.

The surface can be used with caution after 4-6 hours.